

Work Order ID 138676

138676

Page 1

Monday, November 09, 2015 8:21:33 AM

Item ID: D350-748-143TRN

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: SS Crosstube Turning Detail

Start Date: 11/9/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 11/9/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

MCS

Date: NOV 09 2015

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start *NR1*

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D350-748-143

A

OK

15/11/9

100

0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.02

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs on both ends as per Folio

2-Turn first side as per Folio

3- File transition lines smooth.

FOLIO REV: AA

DWG REV: A

110

QC1- Inspection performed by CMM

0.00

110

QC

Memo

0.00

Quality Control

1 0

mmml
15/11/11

1 0

mmml
15/11/12

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Work Order ID 138676

Monday, November 09, 2015 8:21:33 AM

138676

Page 2

Item ID: D350-748-143TRN Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: SS Crosstube Turning Detail
 Start Date: 11/9/2015 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 11/9/2015 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	MORI SEIKI CNC LATHE LARGE	0.00							
120									
Mori Seiki	Memo	0.04							
Mori Seiki CNC Lathe Large	1-Turn second side as per Folio _____ 2- File transition lines smooth. 3-Scribe Part & Batch as per Dwg D350-748-143 FOLIO REV: <u>AA</u> DWG REV: <u>A</u>								<i>man</i> 15/11/16
130	QC1- Inspection performed by CMM	0.00							
130									
QC	Memo	0.00							
Quality Control									<i>man</i> 15/11/16
140	QC8- Inspect parts - second check	0.00							
140									
QC	Memo	0.00							
Quality Control									<i>man</i> 15/11/16 JAS 47 9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____					

Work Order ID 138676

138676

Page 3

Monday, November 09, 2015 8:21:33 AM

Item ID: D350-748-143TRN

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: SS Crosstube Turning Detail

Start Date: 11/9/2015 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 11/9/2015 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
150		0.00							
150	Large Fab								
Crosstubes	Memo	0.01							
Crosstubes	1-Grind machining marks								
190		0.00							
190	Packaging								
Packaging	Memo	0.00							
Packaging	Identify and stock in kanban rack								
	Location: <u>LG03</u>								
200		0.00							
200	QC21- Final Inspection - Work Order Release								
QC	Memo	0.00							
Quality Control									

MLJ 15-11-23

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval				
Description Work Order Deviation				Disposition							
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐		☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter		☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes		☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center		☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence	
				OTHER :							

Monday, November 09, 2015 8:21:36 AM

Work Order ID: 138676

138676

Parent Item: D350-748-143TRN

D350-748-143TRN

Parent Item Name: SS Crosstube Turning Detail

Start Date: 11/9/2015**Required Date:** 11/9/2015**Start Qty: 1.00**

Required Qty: 1.00

Comments: NEW ISSUE - PRELIM - LL 12.05.08

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6021-125		Manufactured	No				Each	87.0000		1			

D6021-125

Crosstube Material - 17-4Ph SS

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
HALL	55	
127271	35	
85076	20	
ES	32	
Hall 127272	32	

_____ man 15/11/11

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY							
Environment ☐	☐	No Re-verification ☐		☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong
Design ☐	☐	Operator ☐		☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions
Doc/Data ☐	☐	Offset/Setup ☐		☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance
Equip/Tooling ☐	☐	Supplier ☐		☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect
Handling/Pre ☐	☐	Training ☐		☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing
Material ☐	☐	Use for Testing ☐		☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved
Internal Transport ☐	☐	Poor Information ☐		☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing
Tribal Knowledge ☐	☐	Rushing ☐		☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish
LOA ☐	☐	Product Improvement ☐		☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread
Substation ☐	☐	Process Improvement ☐		☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence
Past Expiry Date ☐	☐	Manufacturing Process ☐		OTHER : _____							
Misidentified ☐	☐	Past Due ☐									


DART AEROSPACE LTD		Work Order: 138676
Description: Crosstube Assembly (AS350/355 High Fwd SS)		Part Number: D350-748-143
Inspection Dwg: D350-748-143 Rev: A		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+/-0.005	2.242	/	vern	CNC-OS
	2.180	+0.005/-0.000	2.182	/		
	2.180	+0.005/-0.000	2.181	/		
	2.237	+0.005/-0.000	2.239	/		
	2.272	+0.005/-0.000	2.274	/		
	2.306	+0.005/-0.000	2.308	/		
	2.339	+0.007/-0.000	2.343	-		
	2.339	+0.007/-0.000	2.343	-		
	0.062	+/-0.010	.062	-	vern	CNC-OS
	5.25	+/-0.060	5.25	-	"	
	R0.063	+/-0.010	.063	-	RG	
	R0.50	+/-0.030	.500	/	"	
SIDE B	2.240	+/-0.005	2.242	/	vern	CNC-OS
	2.180	+0.005/-0.000	2.182	/		
	2.180	+0.005/-0.000	2.182	/		
	2.237	+0.005/-0.000	2.239	/		
	2.272	+0.005/-0.000	2.274	/		
	2.306	+0.005/-0.000	2.309	/		
	2.339	+0.007/-0.000	2.342	-		
	2.339	+0.007/-0.000	2.344	-		
	0.062	+/-0.010	.062	/	vern	CNC-OS
	5.25	+/-0.060	5.26	/	"	
	R0.063	+/-0.010	.063	/	RG	
	R0.50	+/-0.030	.500	/	"	
	112.27	+/-0.060	112.27	/	tape	LG-11

DART AEROSPACE LTD		Work Order: 138676
Description: Crosstube Assembly (AS350/355 High Fwd SS)		Part Number: D350-748-143
Inspection Dwg: D350-748-143 Rev: A		Page 2 of 2

WALL THICKNESS MEASUREMENT

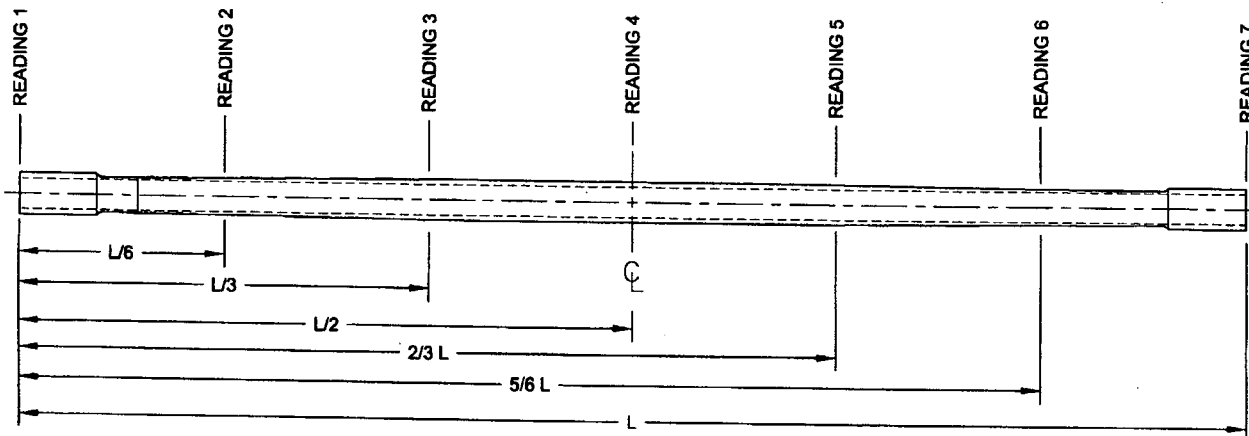

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.119	.126	.123	.117	.009	0.030"
READING 2 L= 19	.116	.138	.136	.117	.022	
READING 3 L= 37	.167	.173	.177	.173	.010	
READING 4 L= 56	.168	.172	.174	.170	.006	
READING 5 L= 75	.167	.172	.176	.171	.009	
READING 6 L= 93	.123	.129	.131	.125	.008	
READING 7 L= 112	.128	.129	.115	.115	.014	

Calibration Result

Actual Block Thickness: 100 - 500

DAS 47 Sitescan 250 Measured Thickness: 100 - 500

Measured by: <i>mmj</i>
Date: 15/11/17

Audited by: 9-89
Date: 15-11-17

Preliminary Approval:
Date:

Rev	Date	Change	Revised by	Approved
A	15.09.09	New Issue (P/O D350-748-103)	KJ <i>[Signature]</i>	<i>[Signature]</i>

Item	Qty	Part Number	Description
	-143		
	X	D350-748-143	CROSSTUBE ASSEMBLY (AS 350/355 HI FWD)
1	1	D6021-125	CROSSTUBE
2	2	D3502-1	SUPPORT
3	2	D5123-7	CLAMP CUSHION
4	1	AETC-1032	INSERT
5	2	MS21920-20 OR MS21920-21/-22	CLAMP (PER DART SPEC. M-MS21920-20/-21/-22)
6	1	NAS1149C0363R	WASHER (OR AN960C10)
7	1	NAS1635-3-8	SCREW (OR MS51958-63)
8	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6021-125 (17-4PH)
FINISHED LENGTH AFTER TURNING = 112.270±0.06 (AFTER BENDING/TRIMMING = 110.27 REF)
- FINISH: PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- TOLERANCE: PER DART QSI 018 UNLESS OTHERWISE NOTED.
WALL THICKNESS ECCENTRICITY PER DART QSI 038 7.2
MIN. ALLOWABLE WALL IS -0.020 FROM NOMINAL
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: DART PART NUMBER "D350-748-143" AND BATCH NUMBER ON INSIDE OF CUFF
PER DART QSI 044 6.4 (VIBRATING STYLUS)
- WEIGHT: 30.45 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE, EXCEPT FOR Ø0.290 HOLE.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO CRACKING/CHIPPING/GROOVES.

TURNING

- BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER BENDING.

BENDING

- BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES PER SIDE. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 8% BASED ON O.D. ON TOP HALF OF BEND, AND 8% ON BOTTOM HALF OF BEND.
- MAX AMPLITUDE OF RIPPING ALONG BENT PORTION OF THE TUBE IS 0.030 (ZN A1-3)
- MAX TWIST: WITH XTUBE LAYED FLAT ON SURFACE, THE DIFFERENCE BETWEEN CUFF HEIGHTS FROM THE SURFACE MAY BE NO LARGER THAN 0.38 (ZN C1-3).

ASSEMBLY

- TO INSTALL D3502-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.02" TO 0.05" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- TORQUE CLAMPS 80 TO 80 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

STOCK COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBMITTAL DRAWING
WALL THICKNESS
MIN. ALLOWABLE WALL IS -0.020 FROM NOMINAL

138676 MLS
15-11-05

9/15/11/5
UNDER REVIEW

13/4/24
CUFF 15.561

RELEASED


2015 MAR 18


9/EN15-547

A	NEW ISSUE	CP	15.01.21
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED	A.P.		
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	15.01.21		



DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA		REV. A
DRAWING NO. D350-748-143	SHEET 1 OF 4	
TITLE CROSSTUBE (AS 350/355 HI FWD)	SCALE NTS	

COPYRIGHT © 2016 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR DISSEMINATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

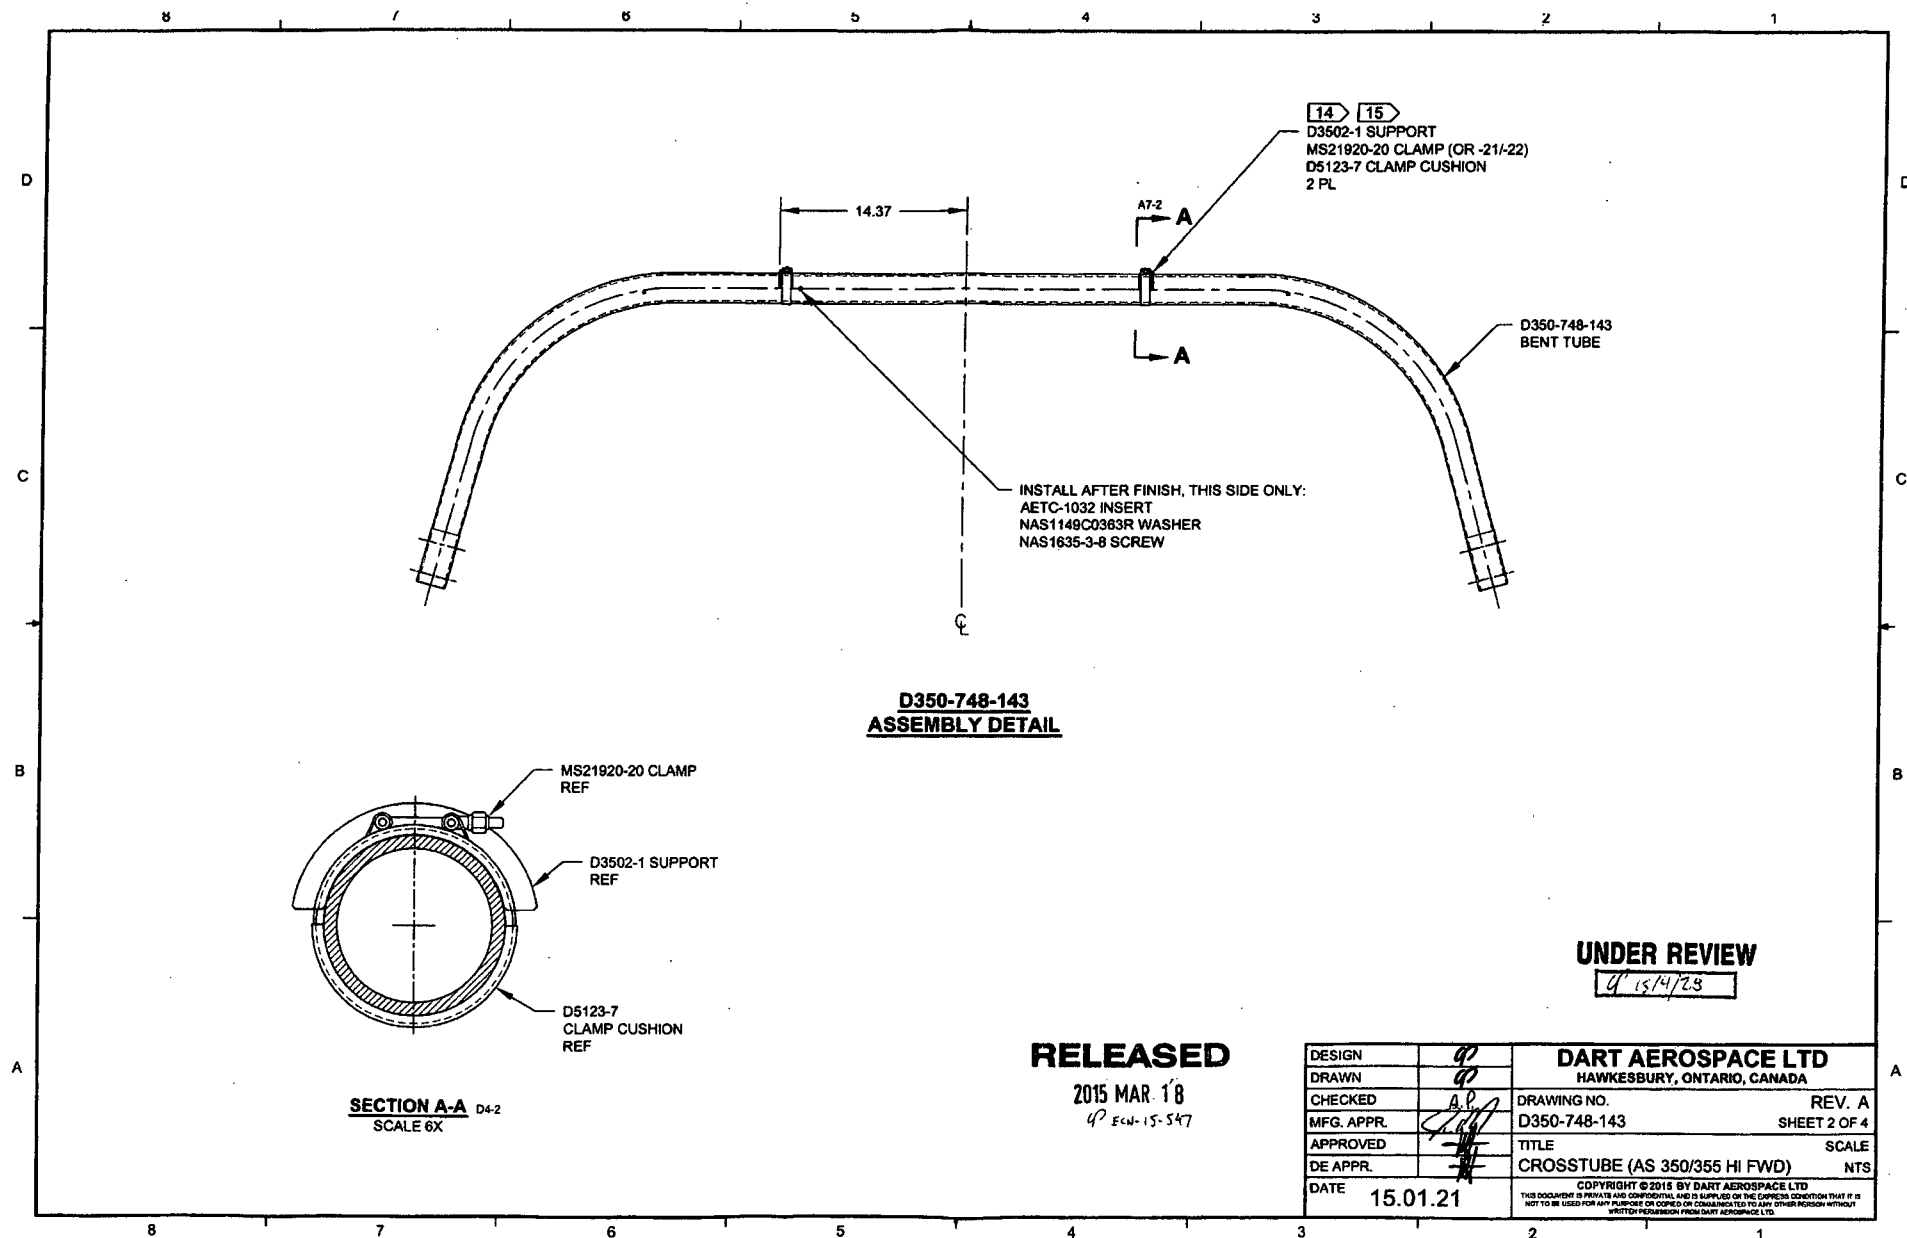

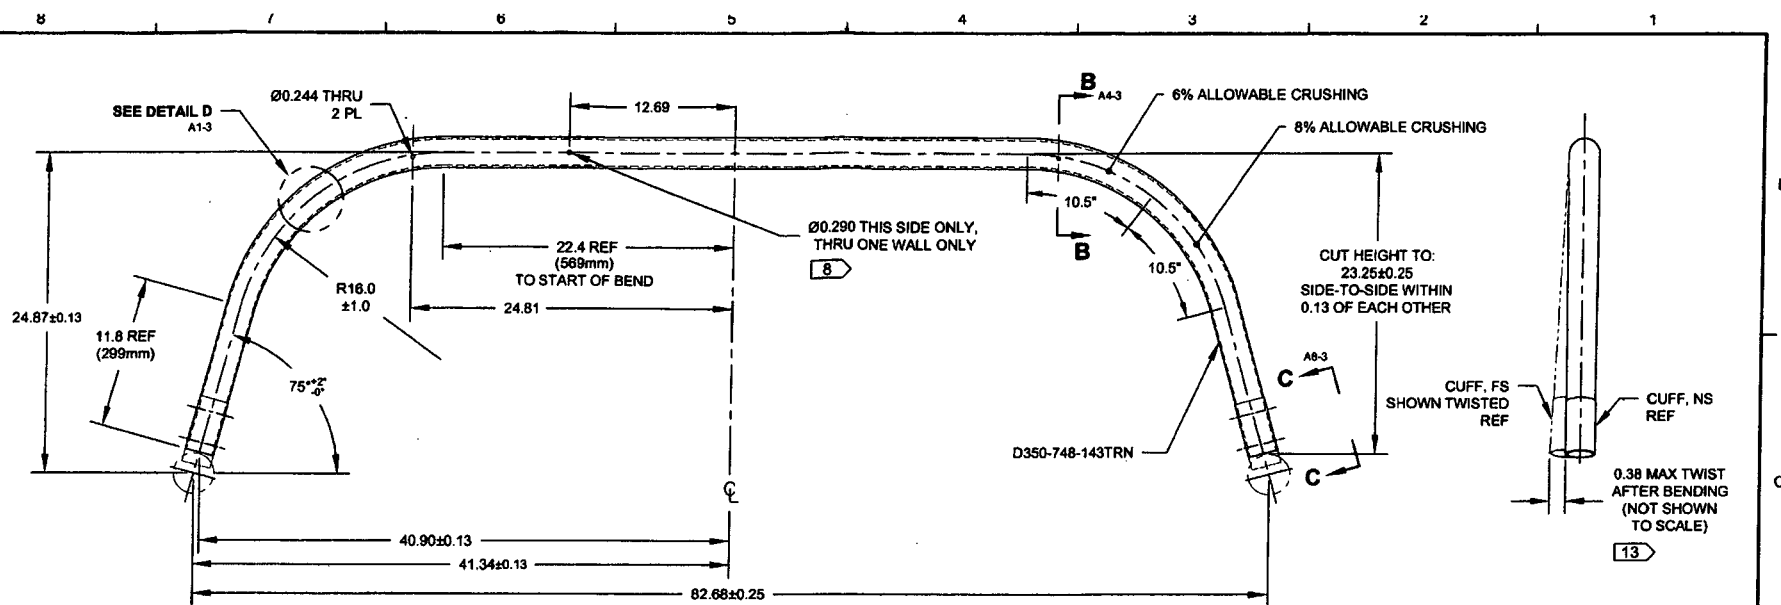

**D350-748-143
BENDING AND DRILLING DETAIL 11**

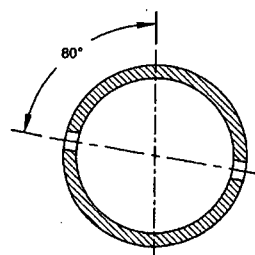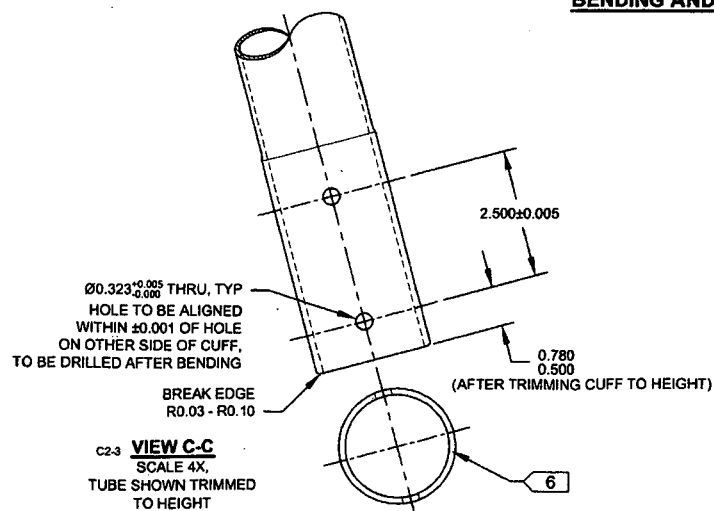


SECTION B-B D3-3
SCALE 6X

RELEASED

2015 MAR 18

UNDER REVIEW


15/14/2B

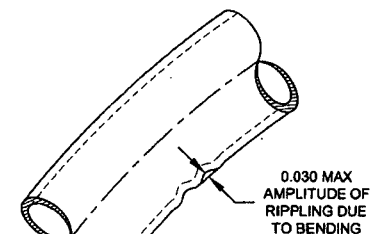

DETAIL D D7-3
SCALE 4X
RIPPLING EXAGGERATED

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED	A.P.	DRAWING NO.	REV.
MFG. APPR.		D350-748-143	SHEET 3 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE (AS 350/355 HI FWD)	NTS
DATE	15.01.21	COPYRIGHT © 2016 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

8 7 6 5 4 3 2 1

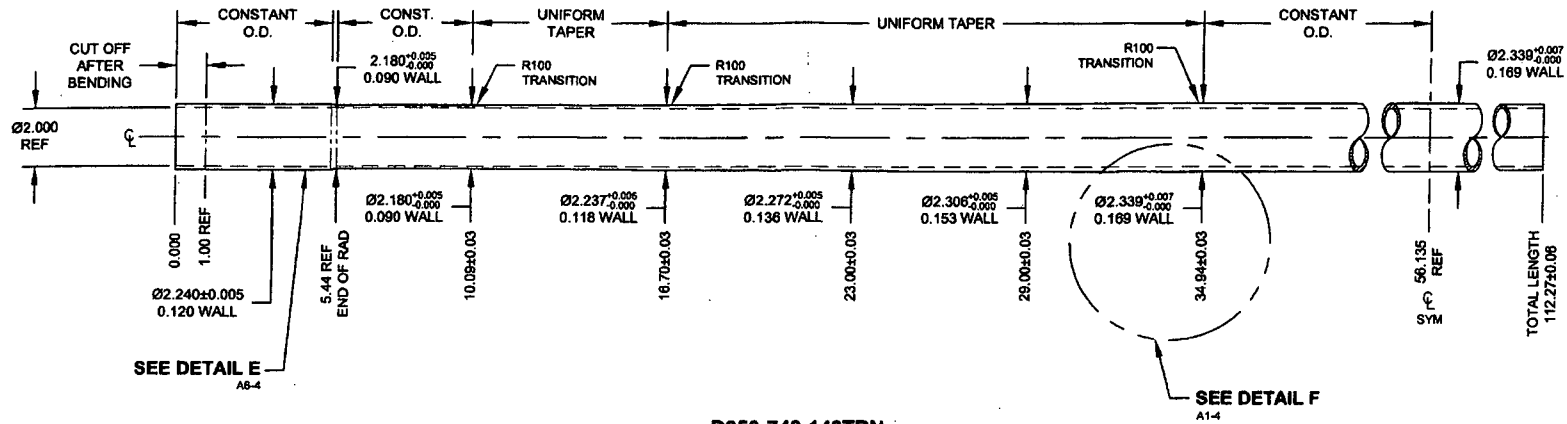


SEE DETAIL E
A8-4



SEE DETAIL F
A1-4

D350-748-143TRN
TURNING DETAIL

RELEASED
2015 MAR 18

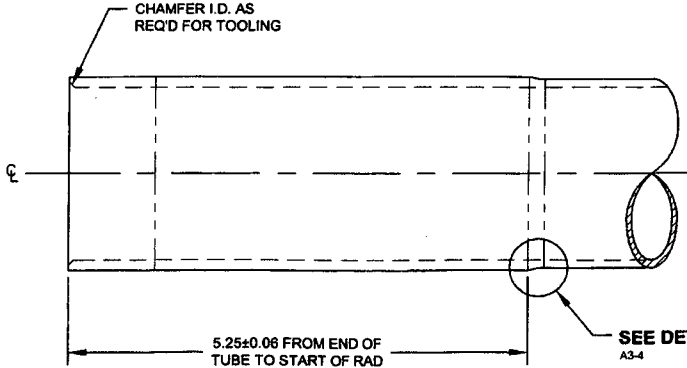

SEE DETAIL G
A3-4

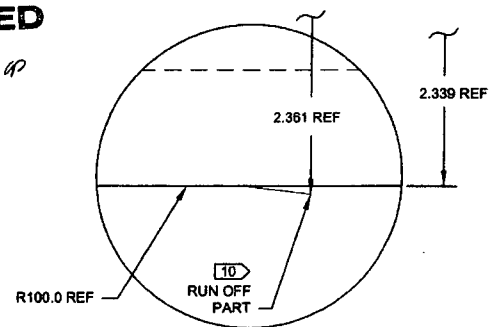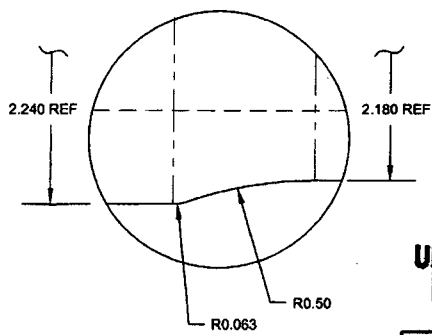

UNDER REVIEW
15/1/20

DESIGN		DART AEROSPACE LTD
DRAWN		HAWKESBURY, ONTARIO, CANADA
CHECKED	A.P.	DRAWING NO. D350-748-143
MFG. APPR.		REV. A SHEET 4 OF 4
APPROVED		TITLE CROSSTUBE (AS 350/355 HI FWD)
DE APPR.		SCALE NTS
DATE	15.01.21	COPYRIGHT © 2015 BY DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

8 7 6 5 4 3 2 1